
44. The Daishoji Earthquake, 1952

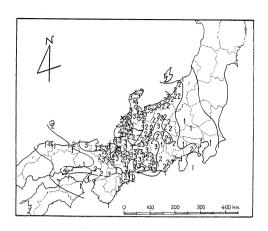


(March 7th, 16:32. 36°30′N, 136°12′E, r=350 km, M=6.8)

It caused comparartively little damage on land owing to its epicenter located at 20 km off Daishōji City. The coastal region near the city sufferred slight damage such as cracks or falling down of housewall and cracks of unconsolited ground along brooks, reclaimed land, lakes and marshes. Damage in Ishikawa Pref.: 7 (5 burnt) dead, 8 injured, 4 half destroyed houses, 82 partly destroyed. 27 burnt, 7 damaged huts, 60 flooding places of cultivated field, 7 bridges, 2 roads.

Seismographs


No Fig.	Station	Int.	Inst.	Comp.	v	Т	r	v	ps	No m.f.
1	Fukui	IV	S		1				25.3	324
2	"	2.	P	∫ N ≀ E	40	3.8	0.03	5 2	25.7	323
3	Wajima	IV	S(C)	$\left\{\begin{array}{l} N \\ E \\ V \end{array}\right.$	1	6.5 6.5 5.0	0.001	6	28.5	504

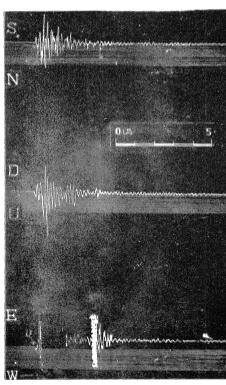


1. Fukui (S)



2. Fukui (P)

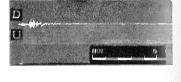

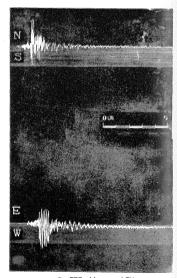

3. Wajima (S)

(July

dama

partly of tending

No Fig.

6